



Main features

- With 4-channel digital monitor DU-4USB (active)
- Dynamic applications
- Presses, injection moulding and die-casting machines
- One system for all tie bar diameters
- Very high accuracy (like bonded strain gauges)
- Measured strain value directly in $\mu\epsilon$, kN or tons
- USB interface for alignment software
- Very compact system and simple application

The magnet-press-on strain sensors QE1008 measure the surface-strain directly at the mounting location, similar to bonded strain gages.

The QE1008 is mounted in seconds and presses strain gages under the stainless protective foil that strongly onto

the surface to be measured that friction replaces the bonding normally used to fix strain gages. The mounting is very fast, and the strain gage is protected. The sensor can not be overloaded.

The sensors do not need to be recalibrated once they have been replaced or remounted.

The all have a standard sensitivity of 2.00 (K-factor).

The QE1008-DU4D Set allows quick alignment of structures (e.g. presses) with 4 tie bars without the need of torque wrenches or any other tool

TECHNICAL DATA

Strain gauge type	Foil (GF = 2.0)
Measuring range	$\pm 800 \mu\epsilon$
Accuracy	$< \pm 0.5\% \text{ FS}$
Linearity	$< \pm 0.5\% \text{ FS}$
Hysteresis	$< \pm 0.5\% \text{ FS}$
Repeatability	$< 0.2\% \text{ FS}$
Supply voltage	none (via USB)
Operating temperature range	5°C to +50°C
Storage temperature range	0°C to +50°C

APPLICATION


SYSTEM CONTAINING:

- 1 Digital monitor type DU-4USB*, works only with PC and our alignment software "Inspectmate 4.0"
- 8 QE1008* magnet sensors incl. 4Y-cable
- Very small carrying case
- Optional PC with software installed

*See dedicated datasheet for technical data

External dimensions of carrying case mm:
400 x 300 x 200

Weight approx. 9 Kg

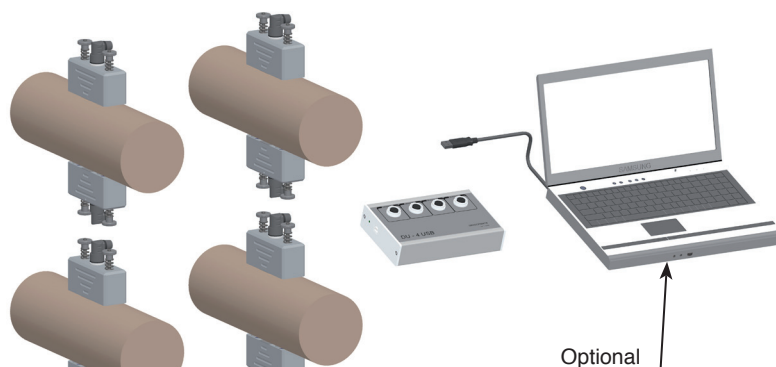

Software can be installed on as many PC's as necessary.

Very compact, connects to PC.

Flexible system with 8 magnet sensors. Measures all tie bar diameters from 45.....>1000mm and even on flat surfaces, detects cracks on tie bar.

Needs no steel bands or other mounting aids -> simple mounting with magnets in minutes!

ORDER CODE

System for tie bar sensors

QE1008 - - **U** -

Number sensors	
8 pieces	08
9 pieces	09
10 pieces	10

Monitor type	
DU-4USB	4U

Cable length	
3 meter	03
5 meter	05
10 meter	10

Features	
US-Tons instead of tons	UST
No features	000

Example: **QE1008 - 08 - 4 U - 05 - 000**

System containing digital monitor type DU-4USB, 8 pieces QE1008 magnet sensors incl. 5 m Y-cable

GEFRAN spa reserves the right to make any kind of design or functional modification at any moment without prior notice.



Sensormate AG
Steigweg 8, - CH-8355 Aadorf, Switzerland
ph: +41(0)52-2421818 - fax: +41(0)52-3661884
Internet: <http://www.sensormate.ch>

GEFRAN spa
via Sebina, 74 - 25050 PROVAGLIO D'ISEO (BS) - ITALY
ph. +39 030 9888.1 - fax. +39 030 9839063
Internet: <http://www.gefran.com>

GEFRAN

DTS_QE-1008-DU-4USB_12-2013_ENG